

Region 4
U.S. Environmental Protection Agency
Science and Ecosystem Support Division
Athens, Georgia

OPERATING PROCEDURE


Title: **Groundwater Level and Well Depth Measurement**

Effective Date: January 29, 2013

Number: SESDPROC-105-R2

Authors

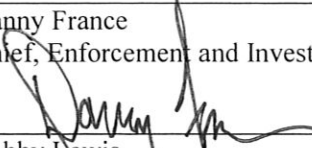
Name: Brian Striggow
Title: Environmental Engineer

Signature: 

Date: 1-22-13


Approvals

Name: Danny France
Title: Chief, Enforcement and Investigations Branch

Signature: 

Date: 1-22-13

Name: Bobby Lewis
Title: Field Quality Manager, Science and Ecosystem Support Division

Signature: 

Date: 1/22/13

Revision History

This table shows changes to this controlled document over time. The most recent version is presented in the top row of the table. Previous versions of the document are maintained by the SESD Document Control Coordinator.

History	Effective Date
<p>SESDPROC-105-R2, <i>Groundwater Level and Well Depth Measurement</i>, replaces SESDPROC-105-R1</p> <p>General: Corrected any typographical, grammatical, and/or editorial errors.</p> <p>Title Page: Changed the Author from Don Hunter to Brian Striggow Changed the EIB Chief from Antonio Quinones to Danny France. Changed the FQM from Laura Ackerman to Bobby Lewis.</p> <p>Revision History: In the 3rd sentence, changed Field Quality Manager to Document Control Coordinator.</p> <p>Section 1.2: Added the following statement: Mention of trade names or commercial products does not constitute endorsement or recommendation for use.</p> <p>Section 1.3: Omitted reference to the H: drive. Changed Field Quality Manager to Document Control Coordinator.</p> <p>Section 1.4: Updated references.</p> <p>Section 2, 1st bullet: Replaced references to “calibration” of groundwater level measuring devices to “verification” of such devices. In the 1st sentence, updated the language to reflect that devices used to measure groundwater levels will be verified annually against a NIST-traceable measuring tape instead of an Invar® steel surveyor’s chain. In the 2nd sentence, added “...with an allowable error of 0.03 feet in the first 30 feet.” Added the last sentence (reference to SESDFORM-043, <i>Well Sounder Function Check and Verification</i> form).</p> <p>Section 3.1, 1st paragraph, last sentence: Rewrote the sentence for clarity. Added the 4th paragraph regarding equilibration of water levels.</p> <p>Added new Section 3.3, <i>Special Considerations for Water Level Measurements at Low Groundwater Gradient</i>. Re-numbered following sub-sections.</p> <p>Section 3.4: Added the 5th sentence and the last sentence.</p>	<p>January 29, 2013</p>

<p>SESDPROC-105-R1, <i>Groundwater Level and Well Depth Measurement</i>, replaces SESDPROC-105-R0</p> <p>General Updated referenced procedures due to changes in title names and/or to reflect most recent version.</p> <p>Title Page Changed title for Antonio Quinones from Environmental Investigations Branch to Enforcement and Investigations Branch.</p> <p>Section 1.3 Updated information to reflect that procedure is located on the H: drive of the LAN.</p> <p>Section 1.4 Alphabetized and revised the referencing style for consistency.</p>	<p>November 1, 2007</p>
<p>SESDPROC-105-R0, <i>Groundwater Level and Well Depth Measurement</i>, Original Issue</p>	<p>February 05, 2007</p>

1 General Information

1.1 Purpose

This document describes general and specific procedures, methods and considerations to be used and observed when determining water levels and depths of wells.

1.2 Scope/Application

The procedures contained in this document are to be used by field investigators to measure water levels and depths of wells. On the occasion that SESD field investigators determine that any of the procedures described in this section are either inappropriate, inadequate or impractical and that another procedure must be used for water level or depth determination, the variant procedure(s) will be documented in the field logbook and the subsequent investigation report, along with a description of the circumstances requiring its use. Mention of trade names or commercial products does not constitute endorsement or recommendation for use.

1.3 Documentation/Verification

This procedure was prepared by persons deemed technically competent by SESD management, based on their knowledge, skills and abilities and has been tested in practice and reviewed in print by a subject matter expert. The official copy of this procedure resides on the SESD Local Area Network. The Document Control Coordinator is responsible for ensuring the most recent version of the procedure is placed on the LAN and for maintaining records of review conducted prior to its issuance.

1.4 References

SESD Operating Procedure for Equipment Inventory and Management, SESDPROC-108, Most Recent Version

SESD Operating Procedure for Field Equipment Cleaning and Decontamination, SESDPROC-205, Most Recent Version

SESD Operating Procedure for Logbooks, SESDPROC-010, Most Recent Version

US EPA. Safety, Health and Environmental Management Program Procedures and Policy Manual. Region 4 SESD, Athens, GA, Most Recent Version

1.5 General Precautions

1.5.1 Safety

Proper safety precautions must be observed when measuring water levels in wells and determining their depths. Refer to the SESD Safety, Health and

Environmental Management Program Procedures and Policy Manual and any pertinent site-specific Health and Safety Plans (HASPs) for guidelines on safety precautions. These guidelines, however, should only be used to complement the judgment of an experienced professional. Address chemicals that pose specific toxicity or safety concerns and follow any other relevant requirements, as appropriate.

1.5.2 Procedural Precautions

The following precautions should be considered when measuring water levels and depths of wells:

- Special care must be taken to minimize the risk of cross-contamination between wells when conducting water level and depth measurements. This is accomplished primarily by decontaminating the sounders or other measuring devices between wells, according to SESD Operating Procedure for Field Equipment Cleaning and Decontamination, (SESDPROC-205) and maintaining the sounders in clean environment while in transit between wells.
- Water levels and well depths measured according to these procedures should be recorded in a bound logbook dedicated to the project as per SESD Operating Procedure for Logbooks (SESDPROC-010). Serial numbers, property numbers or other unique identification for the water level indicator or sounder must also be recorded.

2 Quality Control Issues

There are several specific quality control issues pertinent to conducting water level and depth measurements at wells. These are:

- Devices used to measure groundwater levels will be verified annually against a National Institute of Standards and Technology (NIST) traceable measuring tape.. These devices should check to within 0.01 feet per 10 feet of length with an allowable error of 0.03 feet in the first 30 feet. Before each use, these devices should be prepared according to the manufacturer's instructions (if appropriate) and checked for obvious damage. All verification and maintenance data should be documented electronically or recorded in a logbook maintained at the Field Equipment Center (FEC) as per the SESD Operating Procedure for Equipment Inventory and Management (SESDPROC-108). The functional check and tape length verification should be performed according to the instructions included in SESDFORM-043, *Well Sounder Function Check and Verification*, which also includes the form for recording the required information.
- These devices should be decontaminated according to the procedures specified in the SESD Operating Procedure for Field Equipment Cleaning and Decontamination (SESDPROC-205) prior to use at the next well.

3 Water Level and Depth Measurement Procedures

3.1 General

The measurement of the groundwater level in a well is frequently conducted in conjunction with ground water sampling to determine the “free” water surface. This potentiometric surface measurement can be used to establish ground water direction and gradients. Groundwater level and well depth measurements are needed to determine the volume of water or drawdown in the well casing for proper purging.

All groundwater level and well depth measurements should be made relative to an established reference point on the well casing and should be documented in the field records. This reference point is usually identified by the well installer using a permanent marker for PVC wells, or by notching the top of casing with a chisel for stainless steel wells. By convention, this marking is usually placed on the north side of the top of casing. If no mark is apparent, the person performing the measurements should take both water level and depth measurements from the north side of the top of casing and note this procedure in the field logbook.

To be useful for establishing groundwater gradient, the reference point should be tied in with the NGVD (National Geodetic Vertical Datum) or a local datum. For an isolated group of wells, it is acceptable to use an arbitrary datum common to all wells in that group, if necessary.

Water levels should be allowed to equilibrate prior to measurement after removing sealing caps. There are no set guidelines and appropriate equilibration times can range from minutes to hours depending on well recharge, local geology and topography, and project objectives.

3.2 Specific Groundwater Level Measurement Techniques

Measuring the depth to the free ground water surface can be accomplished by the following methods. Method accuracies are noted for each of the specific methods described below.

- **Electronic Water Level Indicators** – These types of instruments consist of a spool of dual conductor wire, a probe attached to the end and an indicator. When the probe comes in contact with the water, the circuit is closed and a meter light and/or audible buzzer attached to the spool will signal contact. Penlight or 9-volt batteries are normally used as a power source. Measurements should be made and recorded to the nearest 0.01 foot.
- **Other Methods** – There are other types of water level indicators and recorders available on the market, such as weighted steel tape, chalked tape, sliding float method, air line pressure method and automatic recording methods. These methods are primarily used for closed systems or permanent monitoring wells.

