Navajo Abandoned Uranium Mine

Site Screen Report

This form is for use at the site of abandoned uranium mines (AUM) located on Navajo Nation lands. Applicable sites include all mine and mine features that have or have not undergone reclamation by the Navajo Abandoned Mine Lands Reclamation Program, including features, adits, pits and waste piles. Applicable sites also include all AUM sites listed in the USEPA CERCLIS database, all sites listed in the 2008 AUM GIS Report issued by USACOE and USEPA, all AUM sites on allotment lands associated with the Navajo Nation, and any and all AUM sites not listed in any database located on Navajo lands. Reconnaissance of any sites located on lands adjacent to Navajo lands that may be impacting Navajo lands will need to be coordinated with the authorities appropriate to those lands.

The purpose of the form is to ascertain the status and location of the identified AUM site, and record all immediate site information associated with the mine site. Decisions and recommendations on what additional steps are needed will be provided on a separate document.

Lone Star AUM Site

Navajo AUM Northern Region

Prepared by:

Weston Solutions, Inc.

Contract: W91238-06-F-0083

12767.063.496.1111

March 2010

Part I Site Identification, Location and Status

Site Names and ID numbers as applicable

Mine ID: 27

Map ID: N134

CERCLIS: NNN000908834

Navajo Abandoned Mine Land Reclamation Program: NA-0410

Local name / Aliases: VCA Plot 9; East Reservation Lease Plot 9

Chapter and local area: Red Valley Chapter

County: Apache State: Arizona

Lat/Long: 36.7685094906 N / -109.044059796 W

Nearby road and highway: Indian Route 63

Local Post Office: Beclabito, NM

Surface Land Status: check one or more and provide ownership and contact information below

Tribal Trust Land	\bowtie	Public lands
Private		Tribal Fee Land
Bureau of Land Mgmt		Allotment
State		Fee land

Subsurface Mineral Rights:

The mineral rights ownership was identified as Indian.

Claim and operator information:

The mine site surface land status is classified as Tribal Trust Land. Historical documents showed the operator of the mine as Harry Russell in 1950, Raymond Marshall from 1950 to 1951, Vanadium Corp. of America from 1950 to 1952, and Leroy Pettigrew from 1950 to 1952. No other historical ownership / lease information was identified in the EPA/AUM database.

Number of residential structures within 200 feet of mine:

None

Estimated volume of mine waste onsite:

None

Part II Summary of radiological readings

Highest gamma radiation measurement:

31,747 counts per minute (cpm)

Describe any other radiological measurements:

A total of 2,373 gamma radiation measurements were collected from the mine site, ranging from 5,911 cpm to 31,747 cpm. The measurements are represented in Figures 1 and 2.


Background Locations

Average background = 10,144 cpm

#1 10,144 cpm

Distribution Chart and Statistics:

The following chart and statistics were generated by ESRI ArcGIS 9.3.1, and show the general distribution of the site gamma radiation measurements. The horizontal X axis represents the gamma radiation reading levels in cpm (lowest levels to the left). The vertical Y axis represents the frequency of each gamma radiation level.

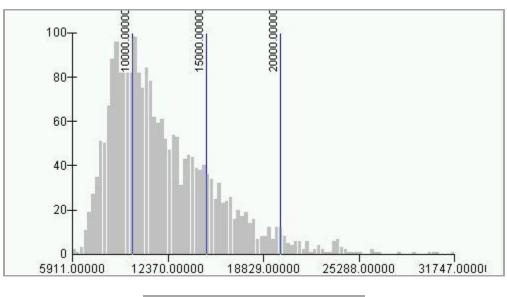

Count:	2373
Minimum:	5911.00000
Maximum:	31747.00000
Sum:	28593784.00000
Mean:	12049.63506
Median:	11102.00000
Standard Deviation:	3621.21648

Part III Status of Reclamation and Mine Waste

The following information was obtained from the Navajo Abandoned Mine Land Reclamation Program (NAMLRP) Point Features Database:

NAMLRP Status of the mine site: Reclaimed : Yes Waste Pile onsite : No

NAMLRP Project Number: NA-0410

NAMLRP Mine features: 1 Prospect

The following information was obtained from field observations collected during the 2009 site screening:

Provide description and status of all mine sites and features at site. Include all waste piles, adits, pits and other features, and indicate whether they are open, closed, covered, capped, buried or unreclaimed. Indicate approximate size, shape and extent, including description of any reclamation caps. Note condition of all caps.

Observed reclamation work and status:

Adits None

Waste Piles None

Pits None

Shafts None

None

Other Debris and Mine Features None

Part IV

Site observations and Environs

Observed Structures: list number of and describe human habitation status of structures at the following distances from mine:

0 to 200 feet: None

200 feet to 0.25 mile: None

Observed Public or commercial structure: list and describe all schools, clinics, Chapter Houses, places of business and any other structure used by members of the community at the following distances:

0 to 200 feet: None

200 feet to 0.25 mile: None

Levels measured around the perimeter(s) of the identified structure(s):

None

Observed water sources: list the number and type of wells and surface water sources that are potentially used for human consumption at the following distances from the mine:

0 to 0.25 miles: None

0.25 miles to 4 miles: None

Sensitive environments: note and describe all sensitive environments located within visible range of the mine site, including: wetlands, endangered species, habitats and approximate locations of sites that may be under protection of the government of the Navajo Nation.

None observed

Known Site History: include information from interviews with Chapter officials and residents. Note information on mine ownership, type of mining operation, period of operation, known amount of production, and any other information as provided.

Lone Star mine consists of an area of 29,298.72 m². The mine was identified as being operational from 1950 to 1962. Historical documents showed the operator of the mine as Harry Russell in 1950, Raymond Marshall from 1950 to 1951, Vanadium Corp. of America from 1950 to 1952, and Leroy Pettigrew from 1950 to 1952. While operational, the mine had a total reported production volume of 200 tons. No other historical information or any additional ownership / lease information was identified in the EPA/AUM database.

Part V Response Action Summary

Site Name(s): Lone Star Chapter: Red Valley

Decision Criteria

Is there an unreclaimed waste pile at the site? No

At what distance from the waste pile is the nearest residential structure located? None

At what distances from the waste pile are there potential drinking water sources? None

Is there a reclamation cap or sealed adit in place at the site? No

Is the cap/seal functionally intact? None

Is the cap/seal sufficiently degraded to create a concern about releases? No

At what distance from the cap/seal is the nearest domestic structure located? None

At what distance from the cap/seal is the nearest domestic drinking water source? None

Summary of emergency response factors

None

Summary hazard ranking system factors

None

Summary of reclamation factors

None

Part VI Photos



Photo 1. Mine site



Photo 2. Mine site



Photo 3. Mine site

Photo



Photo 4. Drainage/road area



Photo 5. Mine site slope area

Part VII Contacts Reports and Information

Name: <u>Stanley Edison (928) 871-6861</u>

Eugene Esplain (928) 871-7331

Title or official role (if any) Navajo EPA Superfund Program

Address PO Box 2946, Window Rock, AZ 86515

Information provided <u>Lead Regulatory Agency</u>

Name	
Title or official role (if any)	
Address	-
Telephone number	
Information provided	
Name	
Title or official role (if any)	
Telephone number	
Information provided	
Name	
Title or official role (if any)	
Telephone number	
Information provided	

Figure 1 - Gamma Radiation Measurements, Above Two Times Background Lone Star (27) Red Valley Chapter, Navajo Nation, Arizona


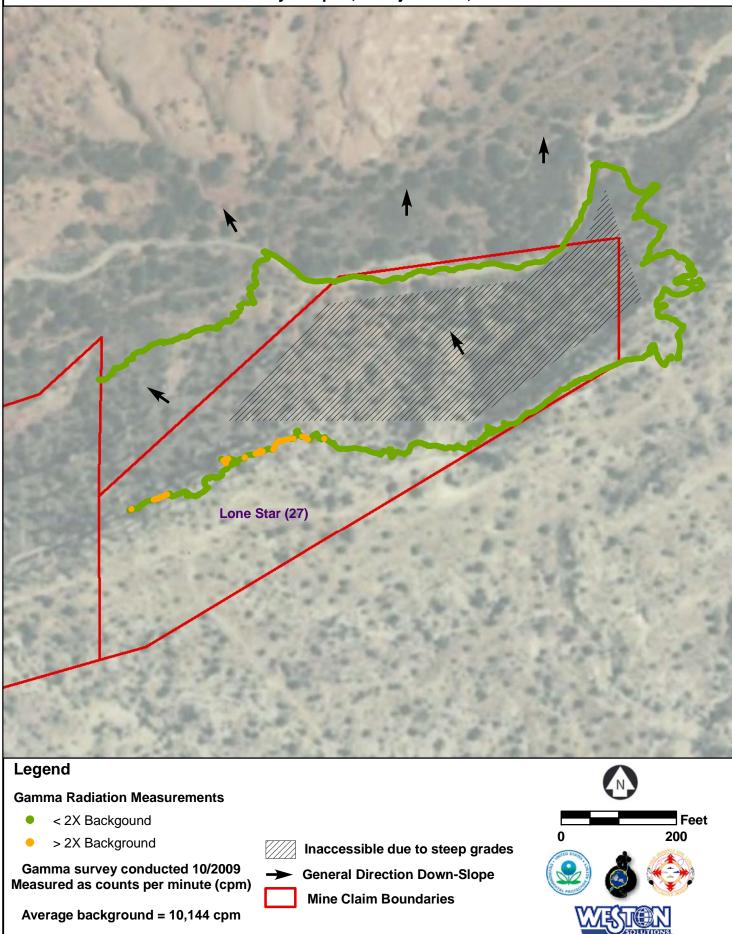


Figure 2 - Gamma Radiation Measurements Lone Star (27) Red Valley Chapter, Navajo Nation, Arizona

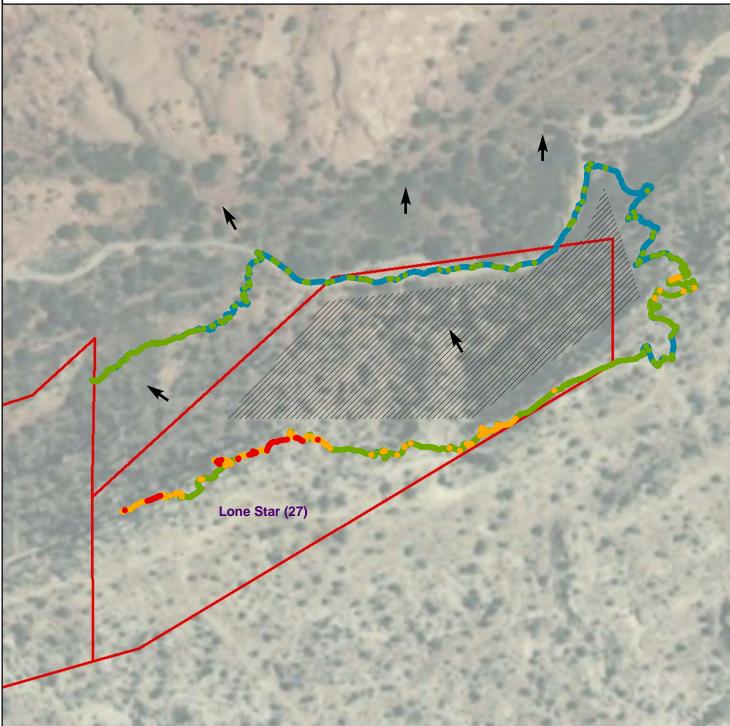

Legend

Gamma Radiation Measurements

- 0 10,000
- 10,000 15,000
- 15,000 20,000
- 20,000 50,000
- 50,000 100,000
- > 100,000

- Inaccessible due to steep grades
 - General Direction Down-Slope
- Mine Claim Boundaries
- Gamma survey conducted 10/2009 Measured as counts per minute (cpm)

Average background 10,144 cpm

