Navajo Abandoned Uranium Mine

Site Screen Report

This form is for use at the site of abandoned uranium mines (AUM) located on Navajo Nation lands. Applicable sites include all mine and mine features that have or have not undergone reclamation by the Navajo Abandoned Mine Lands Reclamation Program, including features, adits, pits and waste piles. Applicable sites also include all AUM sites listed in the USEPA CERCLIS database, all sites listed in the 2008 AUM GIS Report issued by USACOE and USEPA, all AUM sites on allotment lands associated with the Navajo Nation, and any and all AUM sites not listed in any database located on Navajo lands. Reconnaissance of any sites located on lands adjacent to Navajo lands that may be impacting Navajo lands will need to be coordinated with the authorities appropriate to those lands.

The purpose of the form is to ascertain the status and location of the identified AUM site, and record all immediate site information associated with the mine site. Decisions and recommendations on what additional steps are needed will be provided on a separate document.

Frank Jr. Mine AUM Site

Navajo AUM Northern Region

Prepared by:

Weston Solutions, Inc.

Contract: W91238-06-F-0083

12767.063.496.1111

March 2010

Part I **Site Identification, Location and Status** Site Names and ID numbers as applicable Mine ID: 421 Map ID: N202 **CERCLIS:** NNN000908886 Navajo Abandoned Mine Land Reclamation Program: None **Local name / Aliases:** None **Chapter and local area:** Red Valley Chapter County: Apache State: Arizona **Lat/Long:** 36.5458114344 N / -109.247105104 W **Nearby road and highway:** Indian Route 33 **Local Post Office:** Cove, AZ Surface Land Status: check one or more and provide ownership and contact information below **Tribal Trust Land Public lands Private Tribal Fee Land Bureau of Land Mgmt Allotment** State Fee land **Subsurface Mineral Rights:** No information on subsurface mineral rights ownership was found in the EPA/AUM Database. **Claim and operator information:** The mine site surface land status is classified as Tribal Trust Land. Historical documents showed the operator of the mine as Cato Sells from 1951 to 1953, and Climax Uranium from 1960 to 1967. No other historical ownership / lease information was identified in the EPA/AUM database. Number of residential structures within 200 feet of mine: None **Estimated volume of mine waste onsite:** 185 vd^3

Part II Summary of radiological readings

Highest gamma radiation measurement:

585,086 counts per minute (cpm)

Describe any other radiological measurements:

A total of 6,242 gamma radiation measurements were collected from the mine site, ranging from 5,780 cpm to 585,086 cpm. Measurements in the vicinity of the waste debris bench area were found at levels above 500,000 cpm. The measurements are represented in Figures 1 and 2.


Background Locations

Average background = 8,503 cpm

#1 7,554 cpm #2 9,252 cpm

Distribution Chart and Statistics:

The following chart and statistics were generated by ESRI ArcGIS 9.3.1, and show the general distribution of the site gamma radiation measurements. The horizontal X axis represents the gamma radiation reading levels in cpm (lowest levels to the left). The vertical Y axis represents the frequency of each gamma radiation level.

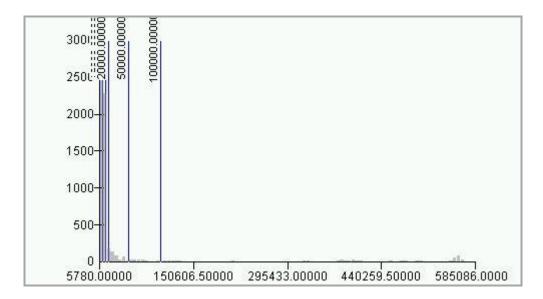

 Count:
 6242

 Minimum:
 5780,00000

 Maximum:
 585086,00000

 Sum:
 307879367,00000

 Mean:
 49323,83323

 Median:
 12336,00000

 Standard Deviation:
 119965,37610

Part III Status of Reclamation and Mine Waste

The following information was obtained from the Navajo Abandoned Mine Land Reclamation Program (NAMLRP) Point Features Database:

NAMLRP Status of the mine site: Reclaimed: No Waste Pile onsite: Yes

NAMLRP Project Number: None

NAMLRP Mine features: 1 Prospect

The following information was obtained from field observations collected during the 2009 site screening:

Provide description and status of all mine sites and features at site. Include all waste piles, adits, pits and other features, and indicate whether they are open, closed, covered, capped, buried or unreclaimed. Indicate approximate size, shape and extent, including description of any reclamation caps. Note condition of all caps.

Observed	recla	mation	work	and	status:
COUNCI VCU	i ccia	HIALIVII	WUIK	anu	Status.

Adits

None

Waste Piles

Waste pile falling down steep slope, 50' x 20', with a total estimated volume of 185 yd³

Pits

None

Shafts

None

Other Debris and Mine Features

Survey markers, rails and timbers on benched hillside

Part IV

Site observations and Environs

Observed Structures: list number of and describe human habitation status of structures at the following distances from mine:

0 to 200 feet: None

200 feet to 0.25 mile: None

Observed Public or commercial structure: list and describe all schools, clinics, Chapter Houses, places of business and any other structure used by members of the community at the following distances:

0 to 200 feet: None

200 feet to 0.25 mile: None

Levels measured around the perimeter(s) of the identified structure(s):

None

Observed water sources: list the number and type of wells and surface water sources that are potentially used for human consumption at the following distances from the mine:

0 to 0.25 miles: None

0.25 miles to 4 miles: None

Sensitive environments: note and describe all sensitive environments located within visible range of the mine site, including: wetlands, endangered species, habitats and approximate locations of sites that may be under protection of the government of the Navajo Nation.

None observed

Known Site History: include information from interviews with Chapter officials and residents. Note information on mine ownership, type of mining operation, period of operation, known amount of production, and any other information as provided.

Frank Jr Mine consists of an area of 23,153.38 m². The mine was identified as being operational from 1951 to 1967. Historical documents showed the operator of the mine as Cato Sells from 1951 to 1953, and Climax Uranium from 1960 to 1967. While operational, the mine had a total reported production volume of 10,519 tons. No other historical information or any additional ownership / lease information was identified in the EPA/AUM database.

Part V Response Action Summary

Site Name(s): Frank Jr Mine **Chapter:** Cove

Decision Criteria

Is there an unreclaimed waste pile at the site? Yes

At what distance from the waste pile is the nearest residential structure located? None

At what distances from the waste pile are there potential drinking water sources? None

Is there a reclamation cap or sealed adit in place at the site? None

Is the cap/seal functionally intact? None

Is the cap/seal sufficiently degraded to create a concern about releases? No

At what distance from the cap/seal is the nearest domestic structure located? None

At what distance from the cap/seal is the nearest domestic drinking water source? None

Summary of emergency response factors

None

Summary hazard ranking system factors

None

Summary of reclamation factors

Unreclaimed waste pile

Part VI Photos



Photo 1. Mine site



Photo 2. Top of waste pile area



Photo 3. Mining debris



Photo 4. Mine site down slope.

Name:


Part VII Contacts Reports and Information

Stanley Edison (928) 871-6861

Eugene Esplain (928) 871-7331	
Title or official role (if any) Navajo EPA Superfund Program	
Address PO Box 2946, Window Rock, AZ 86515	
Information provided <u>Lead Regulatory Agency</u>	
Name	
Title or official role (if any)	
Address	
Telephone number	
Information provided	
Name_	
Title or official role (if any)	_
Telephone number	_
Information provided	
Name	
Title or official role (if any)	_
Telephone number	_

Information provided_____

Figure 1 - Gamma Radiation Measurements, Above Two Times Background Frank Jr (421) Cove Chapter, Navajo Nation, Arizona

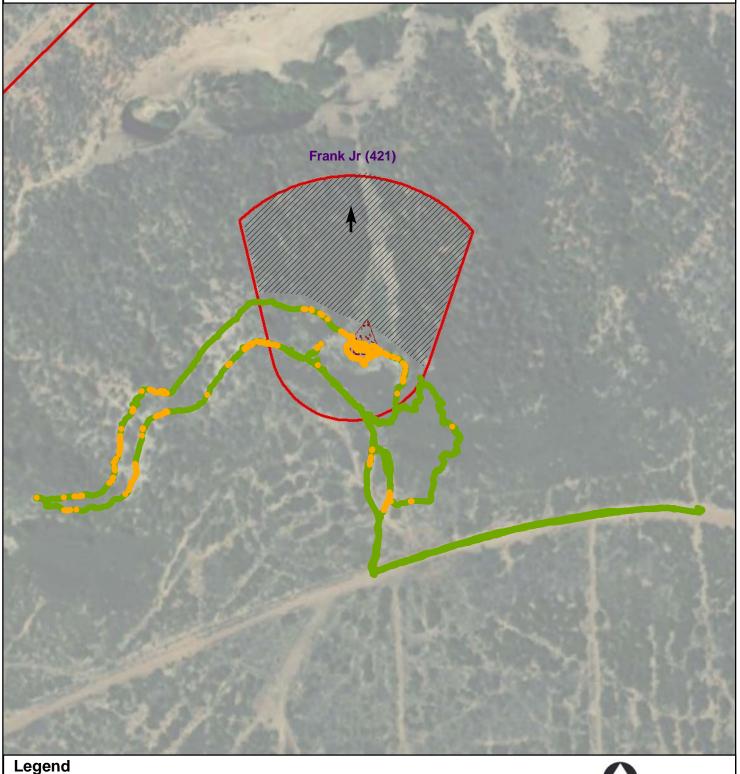

Gamma Radiation Measurements

- < 2X Backgound
- > 2X Background

Gamma survey conducted 10/2009 Measured as counts per minute (cpm)

Average background = 8,403 cpm








Figure 2 - Gamma Radiation Measurements Frank Jr (421) Cove Chapter, Navajo Nation, Arizona

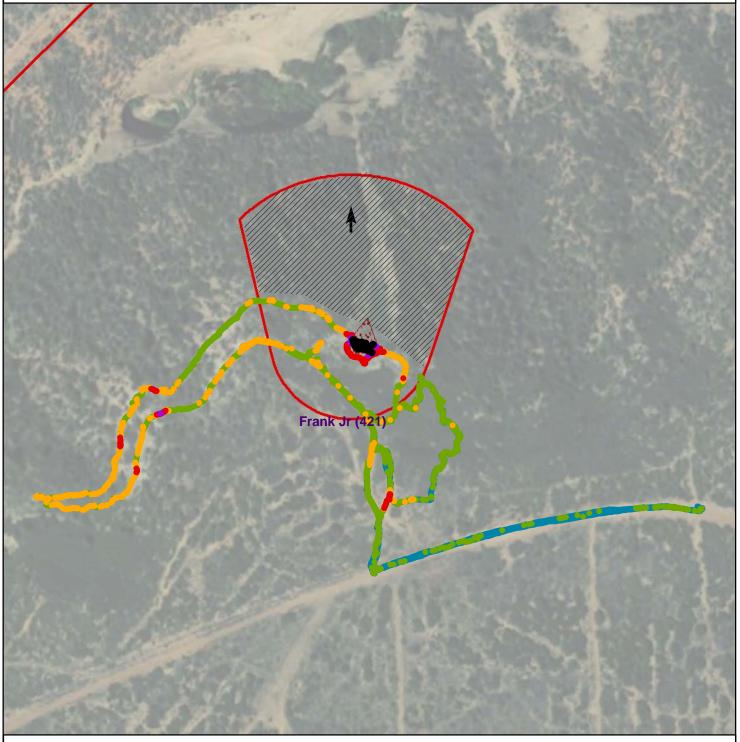

Legend

Gamma Radiation Measurements

- 0 10,000
- 10,000 15,000
- 15,000 20,000
- 20,000 50,000
- 50,000 100,000
- > 100,000



Inaccessible due to steep grades



Mine Claim Boundaries

Gamma survey conducted 10/2009 Measured as counts per minute (cpm)

Average background 8,403 cpm

